

## TECHNICAL SERVICE BULLETIN

### TB08-102 R-M

**TO: NORDYNE DISTRIBUTORS  
NORDYNE DEALERS**  
**FROM: TECHNICAL SERVICE DEPARTMENT**  
**DATE: February 11, 2008**  
**RE: Chattering Check Valve on the GB5BW Air Handlers**

Nordyne has received reports of **GB5BW** air handlers that have a chattering or rattling noise in the coil. The noise is caused by a missing spring in the check valve assembly.


Nordyne is currently working with the manufacture of the check valve to resolve this issue.

In the interim Nordyne recommends that a magnet kit (632392R) should be use to correct the noise issue. Attached are the Installation Instructions for the magnet kit.

If you have any questions contact Nordyne Technical Service at 1-800-422-4328 Ext. 2.

NORDYNE  
Technical Service Department

## 632392R - Magnet Kit GB5BW

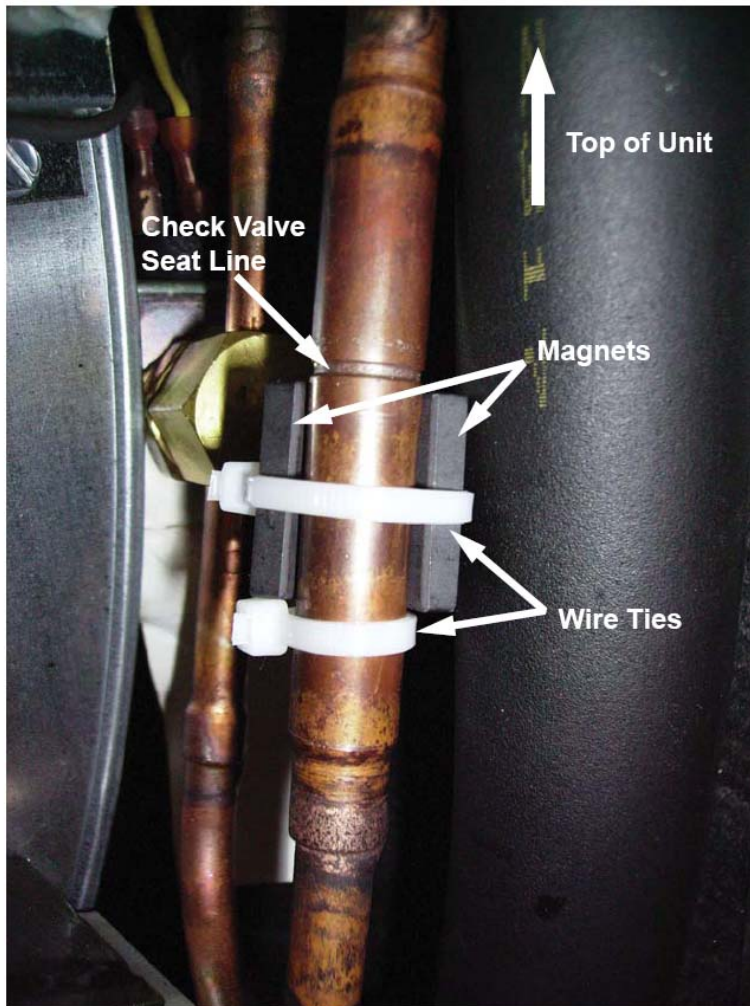

Locate the magnets as shown with the top of each magnet at or slightly below the check valve seat mark on the check valve body.

The top wire tie serves to hold the magnets against the check valve body.

The bottom wire tie can be replaced by tar tape or any other means of preventing the magnets from slipping down the in the check valve.